

# 75a - Air Spring Catalog



**800-255-2052**

[Printer Version](#)

JANUARY 8, 2020

**SECTION 1 - Air Springs by Make**

**SECTION 2 - Air Springs by Number**

**SECTION 3 - Cabin Air Springs**

## **SECTION 1**

A=Aluminum Base

C=Composite Base

[1R12-603](#) (A) Freightliner FASII Airliner (Current Production) - Single/Tandem Axle Air Susp Firestone 9784  
1R12-303 use 1R12-603 Firestone 9780, 5779, Triangle 8382  
2B12-406 Freightliner 16-11378-000 Firestone 7410

FS9394 Fruehauf UCD-9393-2, if bolt is removed this can replace UCE-9393-1

[1R12-281](#) (C), Fruehauf UCE-9393-1 / 3 / 4, Firestone 9130, Triangle 8321

[1R12-092](#) (C) Granning 2727 Firestone 9082

2B9-200 Granning 1371 Firestone 6910, Triangle 4320

[2B9-201](#) (-) Granning 4848 Firestone 6902, 6935, Triangle 4310, 4499

[2B12-307](#) (-) Granning 2725 Firestone 7403 Triangle 4318

[2B14-356](#) (-) Granning 1626 Firestone 7136 Triangle 4321

9307 Firestone (C) SAF Holland 50857000, 90557363, 90557372 Firestone 9307, Triangle AS-8874

[1R12-095](#) (A) SAF Holland 90557011, 90557023, 90557085 Firestone 9039, Triangle 8311

[1R14-028](#) (A) SAF Holland 90557003 Firestone 9177, 9179 Triangle 8316, 8366

[AS-8565](#) (C) Hendrickson C23612 Firestone 9645

FS8710 Hendrickson S-22046 HK230, Firestone 8710

FS8897 Hendrickson S-23114 UBL lift bag, Firestone 7897

[1R12-090](#) (A) Hendrickson S-13033 Firestone 9213, Triangle 8407

[1R12-092](#) (C) Hendrickson B-2066 Firestone 9082

[1R12-095](#) (A) Hendrickson B-11650, B-2064 Firestone 9039, Triangle 8311

1R12-132

[1R12-256](#) [AS-8505](#) (C) Hendrickson S14249, B14249, B4375 Firestone 9367, Triangle 8505

[1R12-365](#) (A) Hendrickson 49048, 49674, 49674-2, Firestone 9466 Triangle 8410, 8411

[1R12-366](#) (A) Hendrickson S-20217 HT190U Firestone 8944, replaces 9015

[1R12-367](#) (A) Hendrickson S-20023 Firestone 9640, Triangle 8427

[1R12-375](#) (C) Hendrickson S-20124 HT250T, HT250U Primaxx, Triangle 8435 Firestone 9265

1R12-403 Hendrickson S-57122-1 HAS Firestone 9373, Triangle 8519

[1R12-404](#) (C) Mack, Hendrickson 50899-1/2, Firestone 9375, Triangle 8451

1R12-424 Hendrickson 50405 Firestone 9287

1R13-038 / 1R14-045 Hendrickson S-22173/S-3830 HT300U Underslung Firestone 9122

1R13-039

[1R13-118](#) (A) Hendrickson S-20127 HT250US Firestone 9262, 9580, Triangle 8434

[1R13-119](#) (A) Hendrickson S-20010 HT230, HS230 Triangle 8433, AS-0084 Firestone 9270  
[1R13-124](#) (A) Hendrickson S-22045 HK190T Slider, Firestone 8755  
[1R13-159](#) (C) Hendrickson S-21800 VANTRAAX® HKANT 46K/HKAT 46K /HKA200 Firestone 8709  
[1R13-176](#) (C) Hendrickson S-22948 VANTRAAX HKANT 40K Firestone 8713 Triangle 8533  
1R13-177 Hendrickson S-21966 use [1R13-176](#)  
[1R14-028](#) (A) Hendrickson B2065 Firestone 9177, 9179 Triangle 8316, 8366  
[1R14-039](#) (A) Hendrickson S-4771 HT300, HS300 Triangle 8320, Firestone 8050  
[1R14-171](#) use [1R13-159](#)  
1R14-171 (C) Hendrickson S-20901(REPLACES S-21784) AAT 25K  
2B9-200 Hendrickson B-8786 Firestone 6910, Triangle 4320  
[2B9-201](#) (-) Hendrickson B-2630 Firestone 6902, 6935, Triangle 4310, 4499  
2B9-206  
[2B10-226](#) (-) Hendrickson S-14486 HLU, PST20 AUX LIFT Firestone 7795, Triangle 4524  
[2B12-307](#) (-) Hendrickson B-1159, B-2883 Firestone 7403 Triangle 4318  
2B12-309  
[2B14-356](#) (-) Hendrickson B-1080 Firestone 7136 Triangle 4321  
2B14-360

[1R12-092](#) (C) Hutch 9630-01 Firestone 9082

[1R11-028](#) (C) Kenworth K-303-6/14/15 Firestone 9422, Triangle 8314  
[1R11-221](#) (A) Kenworth K-303-22, K-303-28 "Airglide" 200/400 Firestone 9622,9675,  
1R12-069 use 1R12-669 Kenworth  
[1R12-669](#) (A) Kenworth Firestone 9069, Triangle 8312

[1R12-365](#) (A) Mack 364SQ28, 57QL411M Firestone 9466 Triangle 8410, 8411  
[1R12-404](#) (C) Mack, Hendrickson 50899-1/2, Firestone 9375, Triangle 8451

1R13-130 Meritor 202796 Firestone 8729

[1R11-166](#) (C) Neway RL-196-15, RL-196-16, 90557121, Firestone 9295, Triangle 8417  
[1R12-090](#) (A) Neway 57009213 Firestone 9213, Triangle 8407  
1R12-103 (A) Neway AR SAF Holland 90044701, 90557008, 90557009, 90557082, Triangle 8315, Firestone 9101  
1R12-508 Neway SAF Holland 90557173 90557223 Firestone 8204, Triangle 8484  
1R12-532 Neway AR SAF Holland 90557157, Firestone 9935, Triangle 8548  
[2B12-307](#) (-) Neway SAF Holland 57007403 Firestone 7403 Triangle 4318  
[352-9807](#) ( ) Neway SAF Holland 50857000, 90557363, 90557972, Firestone 9807, 1R12-1047

[1R12-090](#) (A) Navistar 1660581C1, 501559C1, 501559C2 Firestone 9213, Triangle 8407  
[1R12-401](#) (C) Navistar 1670043C1 Firestone 9371, Triangle 8521  
[1R12-432](#) (C) Navistar 3541731C1 Firestone 9875, Triangle 9875  
[1R12-538](#) (C) Navistar 2027911C1/2/3 Firestone 9648 Triangle 8456  
1R13-038 / 1R14-045 Navistar 1681748C1 Firestone 9122  
[1R14-028](#) (A) Navistar 554779C1 Firestone 9177, 9179 Triangle 8316, 8366  
[2B12-307](#) (-) Navistar 554787C1 Firestone 7403 Triangle 4318

[1R12-069](#) use [1R12-669](#) Peterbilt

[1R12-568](#) (C) Peterbilt 03-07887 Firestone 8852, Triangle 8472  
[1R12-669](#) (A) Peterbilt Firestone 9069, Triangle 8312

1R12-103 (A) Reyco 12883-01 Firestone 9101, Triangle 8315  
[1R12-092](#) (C) Reyco Firestone 9082  
1R13-038 / 1R14-045 Reyco 12883-02 Firestone 9122  
[1R14-039](#) (A) Reyco 23631-01 Triangle 8320, FS 8050

2B12-440 Reyco 20018-01 Firestone 7555

[1R12-095](#) (A) Ridewell 1003589039C Firestone 9039, Triangle 8311

[1R12-256](#) (C) Ridewell Firestone 9367, Triangle 8505

[1R12-261](#) (A) Ridewell Firestone 9241 Triangle 8358, 8361

[1R14-028](#) (A) Ridewell S-2573C, S-4695C, S-4797C, 1003589177C Firestone 9177, 9179 Triangle 8316, 8366

[2B12-307](#) (-) Ridewell 1003587403C Firestone 7403 Triangle 4318

[2B14-356](#) (-) Ridewell 1003587136C Firestone 7136 Triangle 4321

1R12-615 Volvo 3934699 & 8079902 Firestone 8829

1R12-182 Volvo 35003-3201,3,4 Firestone 9219

[2B12-307](#) (-) Volvo 352035001 Firestone 7403 Triangle 4318

FS9321 Watson & Chalin AS-0036

[1R11-028](#) (C) Watson & Chalin AS-0017 Firestone 9422 Triangle 8314

[1R12-095](#) (A) Watson & Chalin AS-0012 Firestone 9039, Triangle 8311

1R12-103 (A) Watson & Chalin AS-0040 Triangle 8315, Firestone 9101

[1R12-256](#) (C) Watson & Chalin AS-0104 Firestone 9367, Triangle 8505

[1R12-261](#) (A) Watson & Chalin AS-0104 Firestone 9241 Triangle 8358, 8361

1R12-580 Watson & Chalin AS-0057 Firestone 9370

1R13-038 / 1R14-045 Watson & Chalin AS-0023 Firestone 9122

[1R14-028](#) (A) Watson & Chalin AS-0010 Firestone 9177, 9179 Triangle 8316, 8366

1R14-039 Watson & Chalin AS- Firestone 8050, Triangle 8320

2B9-200 Watson & Chalin AS-0001 Firestone 6910, Triangle 4320

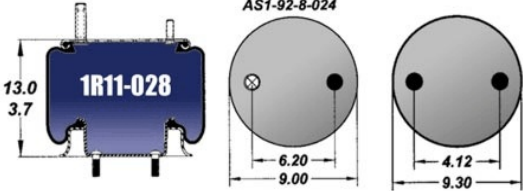
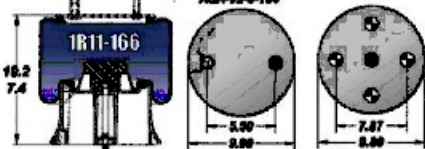
[2B9-201](#) (-) Watson & Chalin AS-0002 Firestone 6902, 6935, Triangle 4310, 4499

[2B9-229](#) (-) Watson & Chalin AS-0058 Firestone 6897, Triangle 4505

[2B12-307](#) (-) Watson & Chalin AS-0007 Firestone 7403 Triangle 4318

[2B14-356](#) (-) Watson & Chalin AS-0004 Firestone 7136 Triangle 4321

## SECTION 2

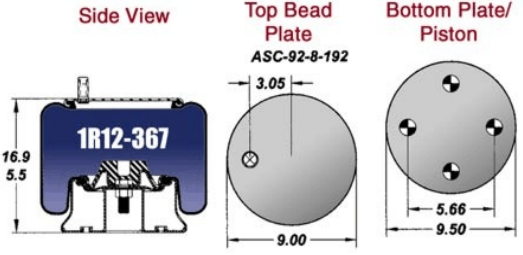
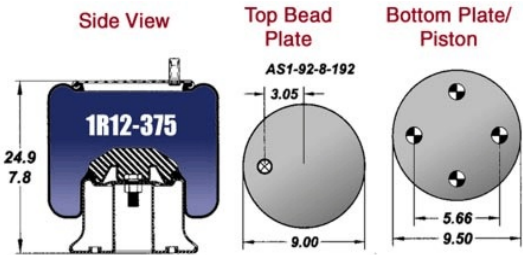
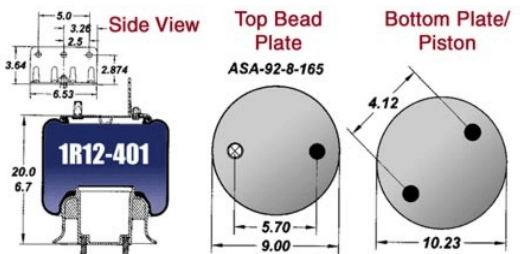
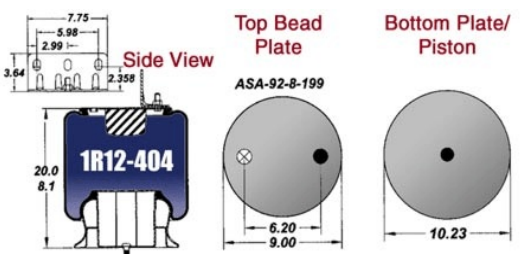

<p><a href="#">1R11-028</a></p>	<p>AS-8314 Replaces 1DK20D9422, 352-9422, 554762C-1, 554762C1, 570-09-422, 9422, M-3525, S-13032, SC2050</p> <p>Supersedes 8314, 85101148, AS-4332, 4332</p> <p>Automann: AB1DK20D-9422</p> <p>COMPOSITE PISTON</p>	<p>Side View      Top Bead Plate      Bottom Plate/ AS1-92-8-024      Piston</p> 
<p><a href="#">1R11-166</a></p>	<p>AS-8417 Replaces 9295, 1DK20E9295, 905-57-121, M-3544</p> <p>COMPOSITE PISTON</p>	<p>Side View      Top Bead Plate      Bottom Plate/ ASA-82-8-166      Piston</p>  <ul style="list-style-type: none"><li>● Bolt or Stud - 1/2-13 or 1/2-20</li><li>⊗ Concentric Side Air Fitting, Stud - 3/4-16; Air Fitting - 1/4 NPTT</li><li>⊕ Trapped Hole on Top Sealers, 3/8-16, on Pistons - 1/2-16</li><li>⊗ Air Fitting - 1/2 NPTT or 3/8 NPTT</li><li>⊗ Air Fitting - 1/4 NPTT      ⊗ Stud, 3/4-16</li></ul>

<p><b><u>1R11-221</u></b></p>	<p>AS-8537 Replaces 9622, K-303-22 Supersedes 8537 <b>ALUMINUM PISTON</b></p>	<p>Side View      Top Bead Plate      Bottom Plate/ Piston</p>
<p><b><u>1R12-069</u></b></p>	<p>USE <b><u>1R12-669</u></b> It has Steel Base AS-8312 Replaces 9069, AS-0077, 03-02456, 03-04759, 03-01649, 03-06746, 03-02038, 03-10042</p> <p>1R12-069 Has Composite Base / 1R12-669 Steel Base</p>	
<p><b><u>1R12-090</u></b></p>	<p>AS-8407 Replaces 1660581C-1, 1660581C1 352-9213, 501559C-1, 501559C-2 501559C1, 501559C2, 570-09-213, 8441 Replaces 1660581C-1, 1660581C1, 1686386C1, 1S12-244, AS-9213, SC2749 Supersedes AS-4477, AS-8441</p> <p>Goodyear is ALUMINUM PISTON all others Composite</p>	<p>Side View      Top Bead Plate      Bottom Plate/ Piston</p>
<p><b><u>1R12-092</u></b></p>	<p>AS-8310 Replaces 1003589082C, 1090217 12882-01, 1DK23K9082, 1R12-092 1R12-093, 1R12-134, 1R12-677, 352-9082 517559C-9, 517559C9, 57QL310, 905-57-006, 905-57-027, 905-57-037 905-57-054, 905-57-075, AS-9082, AB1000CL, AS-0011, CP-5152, H-9630-01, HB800, S-11651, S-12514-007, S-2066 S-36514-7, SC2035, SC2762 Supersedes AS-4314, AS-4389, AS-8310 AS-8350, 85101144 <b>COMPOSITE PISTON</b></p>	<p>Side View      Top Bead Plate      Bottom Plate/ Piston</p>
<p><b><u>1R12-095</u></b></p>	<p>AS-8311 Replaces 101827, 1090218 1090219, 1DK23F9039, 1R12-097, 1R12-122, 352-9039, 554766C1, AS-9039, 905-57-011, 905-57-023, 905-57-085, AS-0012, H-9424-01, H-9424-03, M-3511 P50-734, S-11650, S-2064, SC2033</p> <p>Supersedes 85101153, AS-4319 Goodyear is ALUMINUM PISTON all others Composite</p>	<p>Side View      Top Bead Plate      Bottom Plate/ Piston</p>

<p><b>1R12-103</b></p>	<p>AS-8315 Replaces 1003589101C, 12883-01,1DK23L9101, 1R12-113, 1R12-135, 352-9101, SC2038, 63647, 905-57-008, 905-57-009, 905-57-082, 910, 9102, AB1000AL, AB1000CL, AS-0040, M-3515 Firestone 9101</p> <p>Supersedes AS-4328, 4328, 8315, 85101149 ALUMINUM PISTON</p>	
<p><b>1R12-132</b></p>	<p>AS-8319 Replaces 1003589105C, 1DK23H0725, 352-9105, AS-5065, 554770C1 570-09-105, AS-9105, AS-0015, M-3516 S-1245, SC2039 Supersedes AS-4338, AS-4382, AS-8343</p>	
<p><b>1R12-155</b></p>	<p>AS-8325 Replaces 1R12-358, 1R12-900 352-9096, 570-09-096, AS-9096, S-13049 SC2051, SC2765, UCE-1304-1 Supersedes AS-4355</p>	
<p><b>1R12-256</b> also have <b>AS-8505</b></p>	<p>AS-8361 Replaces 1DK23N9321, 1R12-283, 352-9321, 570-09-321, AS-9321, AS-0036, SC2120, 1R12-335 Supersedes AS-4400, 85101160, AS-4400 AS-8505 Replaces AS-9367, M-3545, S-14249 AS-505 is ALUMINUM PISTON 1R12-256 is ALUMINUM</p>	
<p><b>1R12-261</b></p>	<p>AS-8358 Replaces 1090702, 1681579C1, 9241, 1R12-142, 200041, S-10352, S-4375, SC2108 Supersedes AS-4397, 4397, 8358 ALUMINUM PISTON</p>	



<p><b>1R12-279</b></p>	<p>Replaces 1R12-279, 9094, 9394, M-3546, UCE-9393-1, UCE-9393-2, UCE-9393-4</p> <p>Supersedes 4501, 8383, AS-4501</p>	
<p><b>1R12-281</b></p>	<p>AS-8321 Replaces 1DK23L9130, 1R12-905, 352-9130, 570-09-130, 9130, M-3519, S-13161, SC2464, UCE-9393-1</p> <p>Supersedes 4347, 4496, 8321, 8404, 85101162, AS-4347, AS-8404</p> <p>COMPOSITE PISTON</p>	
<p><b>1R12-303</b></p>	<p>AS-9780, 681320001, Battco: 10-99780 16-13810-000, 16-13840-000 681-320-00-01, 8382P 87-79780, 910S-16P382</p> <p>Automann: AB1DK23K-9780 AB-1R12-303, AS9780 CS112303, E-FS9780, FS9780, M-3550</p> <p>COMPOSITE PISTON USE 1R12-603 ALUMINUM PISTON</p>	
<p><b>1R12-365</b></p>	<p>AS-8410 Replaces 9466, AS0140, 49048, 49207, 49674-1,2</p> <p>ALUMINUM PISTON all others composite</p>	
<p><b>1R12-366</b></p>	<p>AS-8436 Replaces 1R12-271, AS-8944, AS-9015, AS-9349, S-20217, S20217 SC2756</p> <p>ALUMINUM PISTON</p>	

<p><b><u>1R12-367</u></b></p>	<p>AS-8427 Replaces 1R12-266, 352-109, 9630, 9640, S-20223, S20223, SC2758</p> <p>Supersedes 8427 ALUMINUM PISTON</p>	<p>Side View      Top Bead Plate ASC-92-8-192</p>  <p>Bottom Plate/ Piston</p>
<p><b><u>1R12-375</u></b></p>	<p>AS-8435 Replaces 1DK23L9265, 85101155 AS-9265, M-3524, S-20124, SC2759</p> <p>COMPOSITE PISTON</p>	<p>Side View      Top Bead Plate AS1-92-8-192</p>  <p>Bottom Plate/ Piston</p>
<p><b><u>1R12-401</u></b></p>	<p>AS-8521 Replaces 1670043C1, 1R12-401, 9371 Supersedes 8521</p> <p>COMPOSITE PISTON</p>	<p>Side View      Top Bead Plate ASA-92-8-165</p>  <p>Bottom Plate/ Piston</p>
<p><b><u>1R12-404</u></b></p>	<p>AS-8451 Replaces 1S12-031, 364QS27 50899-1, 50899-2, 57QL414M, AS-9375 SC2773</p> <p>Supersedes AS-8440, AS-8519, AS-8520</p> <p>COMPOSITE PISTON</p>	<p>Side View      Top Bead Plate ASA-92-8-199</p>  <p>Bottom Plate/ Piston</p>
<p><b><u>1R12-432</u></b></p>	<p>Navistar 3541731C1 AS-9875, W01-358-9875</p> <p>COMPOSITE PISTON</p>	<p>Side View      Top Bead Plate ASA-92-8-344</p>  <p>Bottom Plate/ Piston M12 X 1.75-6g</p>

<p><b>1R12-532</b></p>	<p>AS-9935, 8548, 64412 ,90557157 910-17.5P548, AS9935 E-FS9935, FS9935</p> <p>COMPOSITE PISTON</p>	
<p><b>1R12-538</b></p>	<p>AS-9648 Replaces 1R12-324, 1S12-017, 2027911C-1, 2027911C1 Supersedes 8456</p> <p>9648, 64263, 1S12-017, 2027911C1 2027911C2, 2027911C3, 910-17.5P456 Automann: AB1DK23K-9648 AS9648, AS-9648, E-FS9648, FS9648</p> <p>COMPOSITE PISTON</p>	
<p><b>1R12-603</b></p>	<p>AS-9781, AS-8382 Replaces 16-13810-000 plastic 16-14377-000, 1D23I9780, 1R12-186 1R12-189, 1R12-303, 681-320-0017 alum</p> <p>9780, 9781, 9782, SC2750, 64266 6813200017, 16-14004-000, 16-14377-000 910S-16A382, AS1R12-603 E-FS9781, FS9781, WO77-9784 Supersedes 4419, 8382, 85101151, AS-4419</p> <p>ALUMINUM PISTON</p>	
<p><b>1R12-669</b></p>	<p>AS-8312 Replaces 03-01649, 03-02038, 03-02456, 03-04759, 03-06746, 03-07112, 1DK23I9069, 352-9069, 554764C1, 570-09-069, AS-9052, AS-9069, M-3512, S-13031, SC2034, 1R12-069</p> <p>Supersedes 85101145, AS-4324, AS-8527 1R12-069 is COMPOSITE PISTON 1R12-669 is ALUMINUM PISTON</p>	
<p><b>1R13-039</b></p>	<p>AS-8317 Replaces 1090023, 12882-02 1D28G9121, 1R13-049, 1R13-067 1R14-043, 352-9121, 554773C1, 905-57-019, 905-57-052, 905-57-078 905-57-083, AS-9121, AS-9123, AS-0013 M-3517, P50-733, S-13160, S-3411</p> <p>Supersedes AS-4322, 85101159, AS-4322</p>	



<p><b>1R13-097</b></p>	<p>AS-8518 Replaces 1001R13097G 1003588778C, 201642, AS-8752</p>	
<p><b>1R13-117</b></p>	<p>AS-8323 Replaces 1003589275C, AS- 4341 AS-4403, 570-09-275, AS- 8362, AS-9275 AS-4341, AS-4403, AS-8362</p>	
<p><b>1R13-118</b></p>	<p>AS-9580, 8434, 8625, 8626, 8627, 9262 9580, 64394, 566263039, 1010-21P434 10-99262, 1R13-081, 1R13-144 566-26-2-039, 87-79580 Automann: AB1DK25C-9580 CS113118, E-FS9262, E-FS9580 FS9262, FS9580 ALUMINUM PISTON</p>	
<p><b>1R13-119</b></p>	<p>AS-8433 Replaces 1DK23I9270, 1R12-255 1R13-077, 85101147, AS-9270, M-3542, S-20010 ALUMINUM PISTON</p>	
<p><b>1R13-124</b></p>	<p>AS-8755 Replaces 8522, 8710, 8755 8758 ALUMINUM PISTON</p>	



<p><b><u>2B9-201</u></b></p>	<p>AS-4310 Replaces 1027505, 200042  354-6902, AS- 4848, 554784C-1  554784C1, 570-06-902, 6902, 85101154  AS-0002, AS-4499, M-3500, S-2630  SC2010, SP2B12R6902</p>	<div style="display: flex; justify-content: space-around;"> <div style="text-align: center;"> <p>Side View</p> </div> <div style="text-align: center;"> <p>Top Bead Plate</p> <p>ASA-92-8-016</p> </div> <div style="text-align: center;"> <p>Bottom Plate/ Piston</p> <p>ASA-92-6-010</p> </div> </div>
<p><b>2B9-206</b></p>	<p>AS-4315 Replaces 1003586905C  1685175C-1, 1685175C1, 354-6905, 45843-1  570-06-905, 6905, 8030120, 85101146  AB1000AL, AS-0020, AS-0032, S-3518  S-45843-1, S-5270, SC2071, SP2B12R6905</p>	<div style="display: flex; justify-content: space-around;"> <div style="text-align: center;"> <p>Side View</p> </div> <div style="text-align: center;"> <p>Top Bead Plate</p> <p>578-92-8-040</p> </div> <div style="text-align: center;"> <p>Bottom Plate/ Piston</p> <p>578-92-6-010</p> </div> </div>
<p><b><u>2B9-229</u></b></p>	<p>AS-4505 Replaces 4505, 6897, AS-0058,  M-3528, SP2B12R6897</p>	<div style="display: flex; justify-content: space-around;"> <div style="text-align: center;"> <p>Side View</p> </div> <div style="text-align: center;"> <p>Top Bead Plate</p> <p>ASA-92-8-113</p> </div> <div style="text-align: center;"> <p>Bottom Plate/ Piston</p> <p>ASA-92-6-077</p> </div> </div>
<p><b>2B9-252</b></p>	<p>AS-4454 Replaces 10307, 6944, SC2124  SPB12RA6944</p>	<div style="display: flex; justify-content: space-around;"> <div style="text-align: center;"> <p>Side View</p> </div> <div style="text-align: center;"> <p>Top Bead Plate</p> <p>ASA-92-8-172</p> </div> <div style="text-align: center;"> <p>Bottom Plate/ Piston</p> <p>ASA-92-6-044</p> </div> </div>
<p><b><u>2B10-226</u></b></p>	<p>AS-4524 Replaces 7795, S-14486, B-14486  Supersedes 4453, 4524, AS-4453</p>	<div style="display: flex; justify-content: space-around;"> <div style="text-align: center;"> <p>Side View</p> </div> <div style="text-align: center;"> <p>Top Bead Plate</p> <p>AS1-92-8-113</p> </div> <div style="text-align: center;"> <p>Bottom Plate/ Piston</p> <p>ASA-92-6-010</p> </div> </div>

<p><b><u>2B12-307</u></b></p>	<p>AS-4318 Replaces 1040201, 2725  2B12-433, 2B12-445, 354-7403, 554787C1  570-07-403, AS-7403, AS-0007, M-3507  S-1159, S-12514-001, S-2883, S-36514-1  SC2021, SP2B22R7403  Supersedes 85101152</p>	<p>Side View      Top Bead Plate      Bottom Plate/  Piston</p>
<p><b>2B12-309</b></p>	<p>AS-4313 Replaces 04-0080, 1027519  16-10769-000, 2726, 2B12-316, 354-7400  554788C1, 570-07-400, 693230, AS-7400  AS-7407, 905-57-016, AS-0003, M-3506  S-1013, SC2020, SP2B22R7400  Supersedes 85101161</p>	<p>Side View      Top Bead Plate      Bottom Plate/  Piston</p>
<p><b>2B12-440</b></p>	<p>AS-4480 Replaces 10315, 18813-01  20018-01, AS-7550, AS-7555, AS-0087  M-3531, XB-SPN-053-37</p>	<p>Side View      Top Bead Plate      Bottom Plate/  Piston</p>
<p><b><u>2B14-356</u></b></p>	<p>AS-4321 Replaces 1027556, 1626  354-7136, 554798C1, 570-07-136  7136, AS-0004, M-3503, S-1080, SC2014  SP2B34R7136  Supersedes 4342 Supersedes AS-4342</p>	<p>Side View      Top Bead Plate      Bottom Plate/  Piston</p>
<p><b>2B14-359</b></p>	<p>AS-4316 Replaces 1015, 1090214  354-7140, 554799C1, 570-07-140, 7140  AS-0008, M-3504, S-3184, SC2015  SP2B34R7140</p>	<p>Side View      Top Bead Plate      Bottom Plate/  Piston</p>

<p><b>2B14-360</b></p>	<p>AS-4311 Replaces 354-7135, 63641, 63644 7135, 905-57-001, AR-21-A, M-3502 S-12514-014, S-13034, SC2013 SP2B34R7135</p>	<p>Side View      Top Bead Plate      Bottom Plate/ Piston</p>
<p><b>3B12-300</b></p>	<p>AS-4431 Replaces 354-8008, 570-08-008 AS-8008, 8030155, AS-0019, S-11637 SC2130</p>	<p>Side View      Top Bead Plate      Bottom Plate/ Piston</p>
<p><b>3B12-303</b></p>	<p>AS-4434 AS-8018, SC2131 AS-4466 Replaces 200117, 3B12-310 AS-8027</p>	<p>Side View      Top Bead Plate      Bottom Plate/ Piston</p>
<p><b>3B14-359</b></p>	<p>AS-4325 Replaces 1014, 354-7818 570-07-818, 7818, 8030180, AS-0025 S-13041, SC2032</p>	<p>Side View      Top Bead Plate      Bottom Plate/ Piston</p>
<p><b><u>AS-8565</u></b></p>	<p>Hendrickson S23612 Suspension AA250L Firestone 9645</p>	



## SECTION 3 Cabin Air Springs

1S5-175 Freightliner Century Class 18-40977-000 7215

**353-7206** Freightliner Century Class ABSZ70-7206 18-29919-000 FS7206,

**353-7207** Freightliner Century ClassST ABSZ70-7207 353-7207 FS7207, 7111, 1840977000

**1S5-040** Freightliner FLD (1988 & later) 1S5-040 7087

FS7205 Freightliner/Wester Star Constellation ABSZ70-7205 66003-3406 7205

FS7201 Freightliner/Sterling Sterling Day Cab, HN-80 Day Cab (1996 & later) ABSZ70-7201 18-45068-00 7201

**1S45-121** Sears Duraform ABSZ70-7035, 7035, S9383

FS7036 Peterbilt Uni-built-highway cab/sleeper (1993 & later) ABSZ70-7036 29-03200 7036

FS7093 Peterbilt Model 387 ABSZ70-7093 29-06016 7093

FS6754 Peterbilt Day Cab (1994 & later) W023586754 20-16754 6754

**1S5-157** Kenworth KW Aerocab (mid 1999 & earlier) 1102-0074 7064,


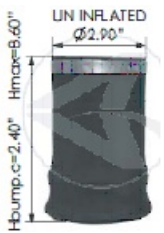
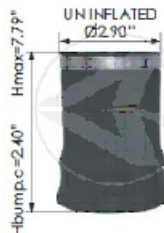


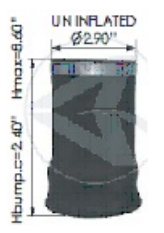
1S5-152 Kenworth T2000 (1998 & later) 1102-0082 7110

**1S4-044** Freightliner Century Class ABSZ70-7206 18-29919-000 Ford, Freightliner, GMC, Kenworth, Navistar,  
Volvo Link Cabmate ABSZ70-7001 1102-0023, 1102-0020 7001

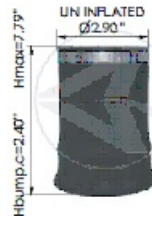
**1S4-123** Ford, Freightliner, GMC, Peterbilt Link Cabmate ABSZ70-7036 1102-0022 7046, 124-035, 11010022

**1S4-058** FS7086 Ford Link Cabmate ABSZ70-7086 1102-0025 FS7086

1S5-038 Navistar Navistar Cab 1102-0076, 1101-0043 7081

<p><b>1S4-044</b></p>		<p><b>1S45-121</b></p>	
<p><b>1S4-123</b></p>		<p><b>1S5-157</b></p>	
<p><b>1S4-058</b></p>		<p><b>1S4-040</b></p>	

**353-7206**



**353-7207**



**WHAT'S**  **NEXT**